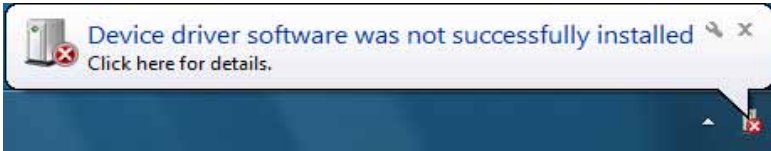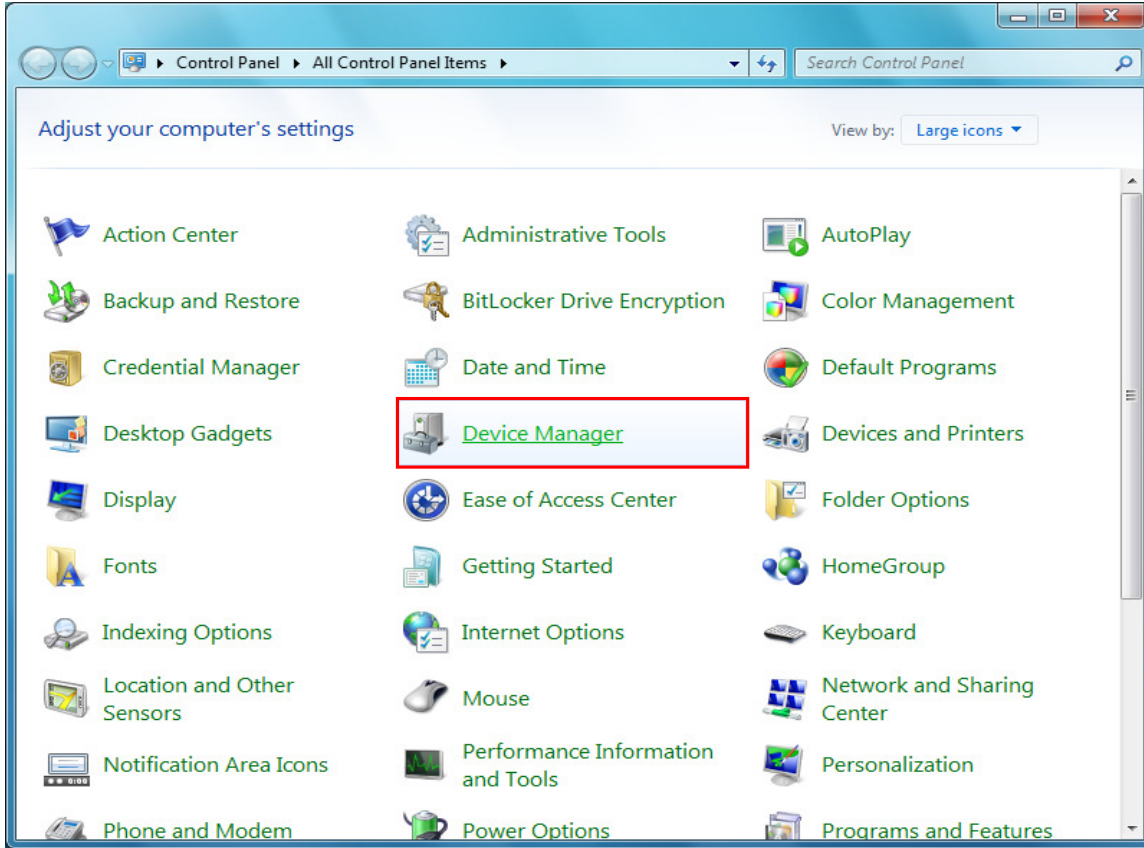# USB Driver Installation
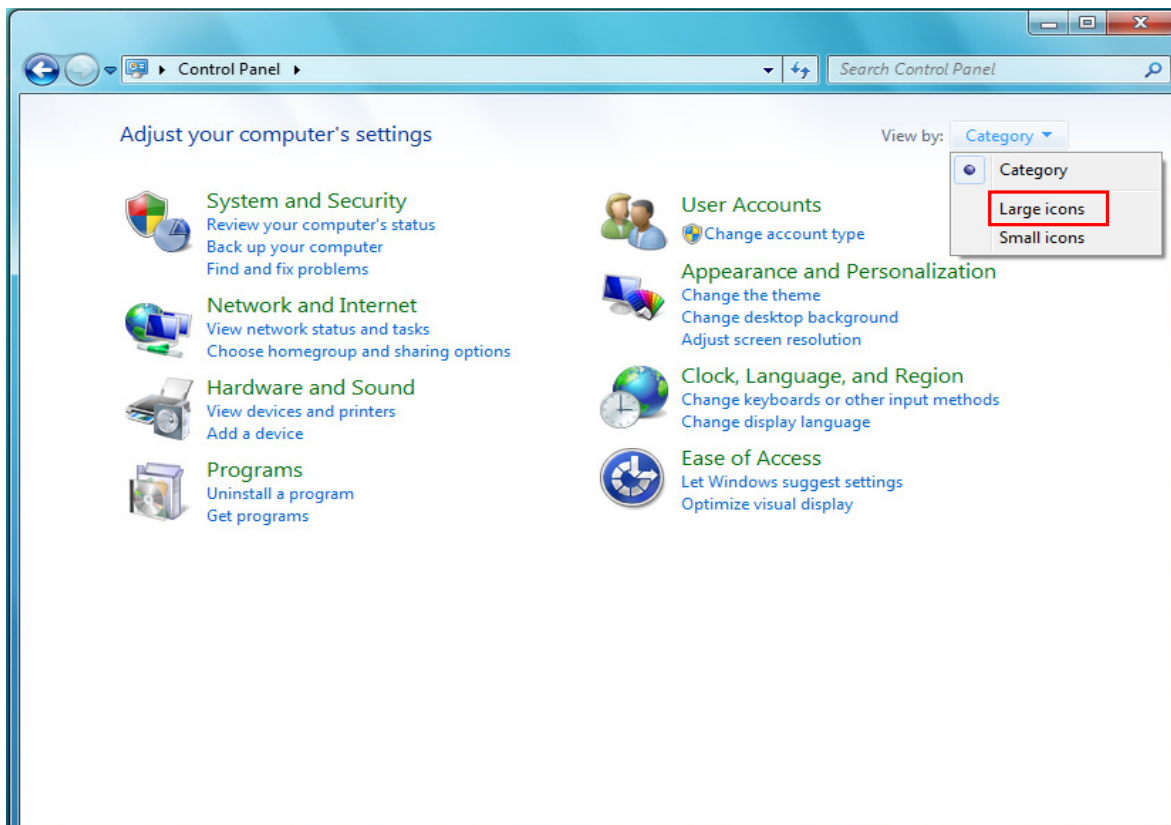
When connecting a product and a PC, when a balloon shown below appears, please install by the following procedure.

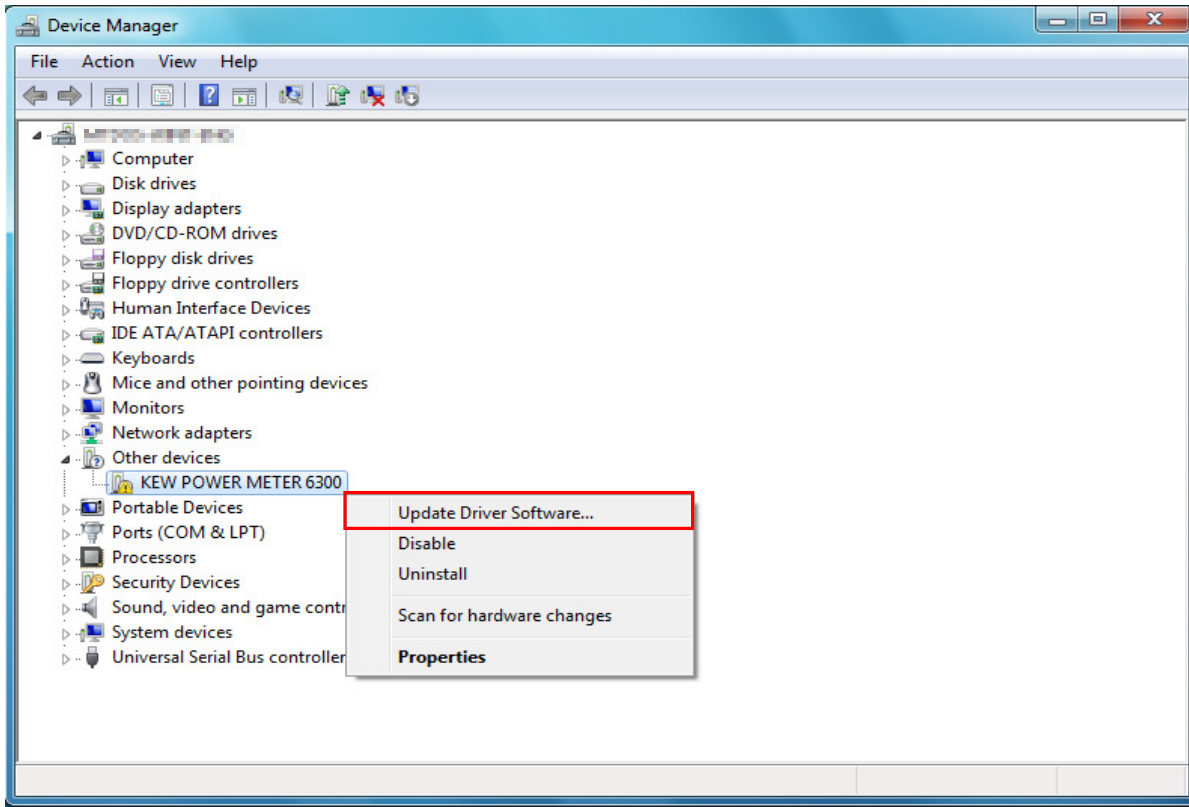Device driver software was not successfully installed
Click here for details.

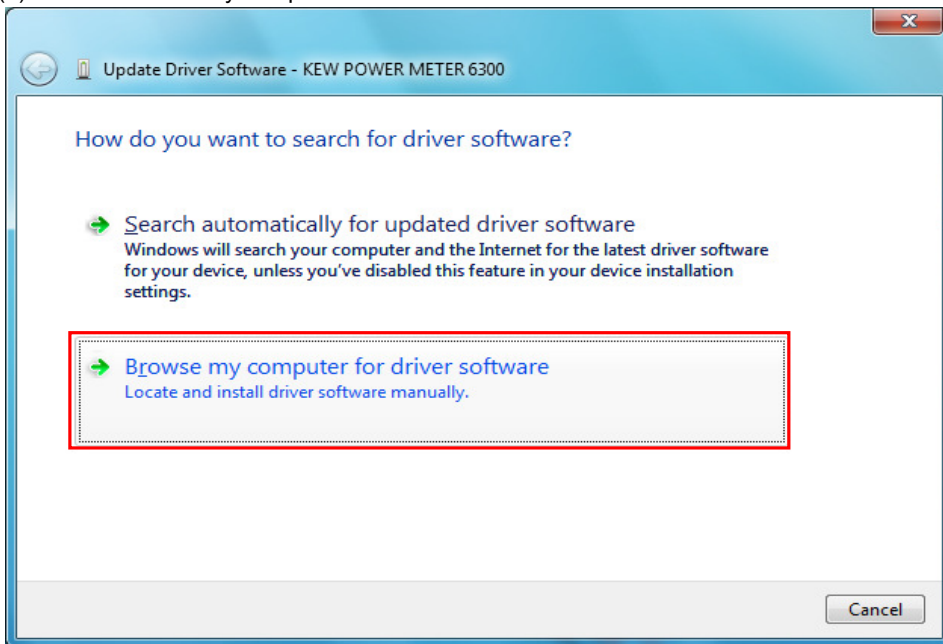(1) Select "Start menu"-> "Control Panel" -> "Device Manager".

*A screen, it seems to be the next, when it is, select "Large icons" from "category".

(2) Right click on "KEW POWER METER 6300" in the "Other devices" from "Device Manager" and select.
    Select "Update Driver Software..." from the inside of the item.

(3) Select "Browse my computer for driver software".

(4) Check the boxes for "Include subfolders", and then click "Browse".

(5) Select a folder to download the file.

(6) It's confirmed that a chosen folder is indicated, and click "Next".

(7) In case that following window appears on Windows Vista, click "Install this driver software anyway".
(It is an operation check, and no problem happens if install is continued.)

(8) Install is completed when the wizard finishes. Click "Close".

(9) After installation has ended, when a balloon shown below appears, please install by the following procedure.

Device driver software was not successfully installed ↘ ✕
Click here for details.

(10) Right click on "USB Serial Port" in the "Other devices" from "Device Manager" and select.
      Select "Update Driver Software..." from the inside of the item.
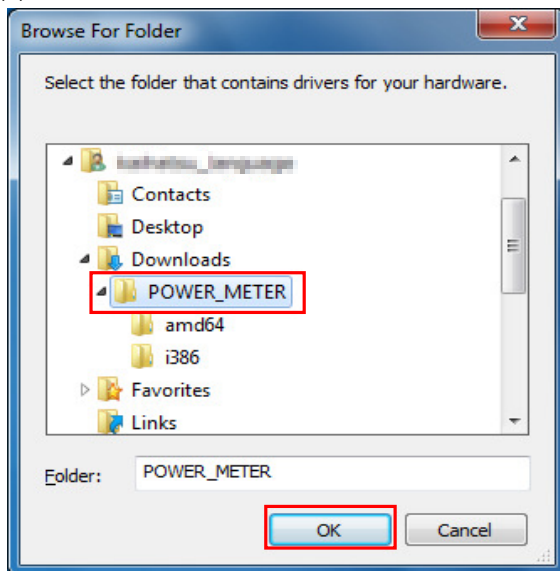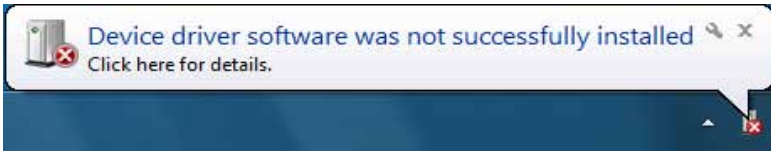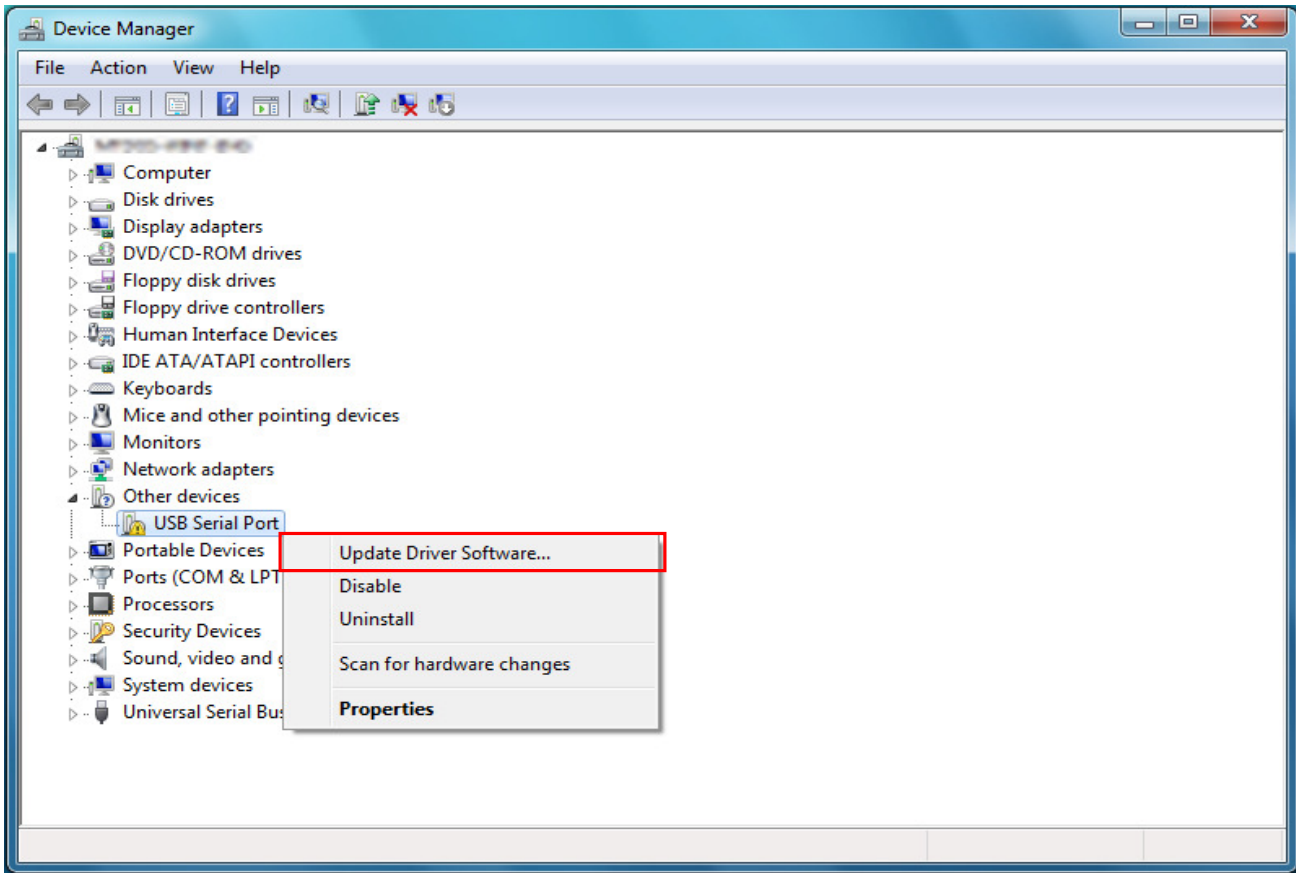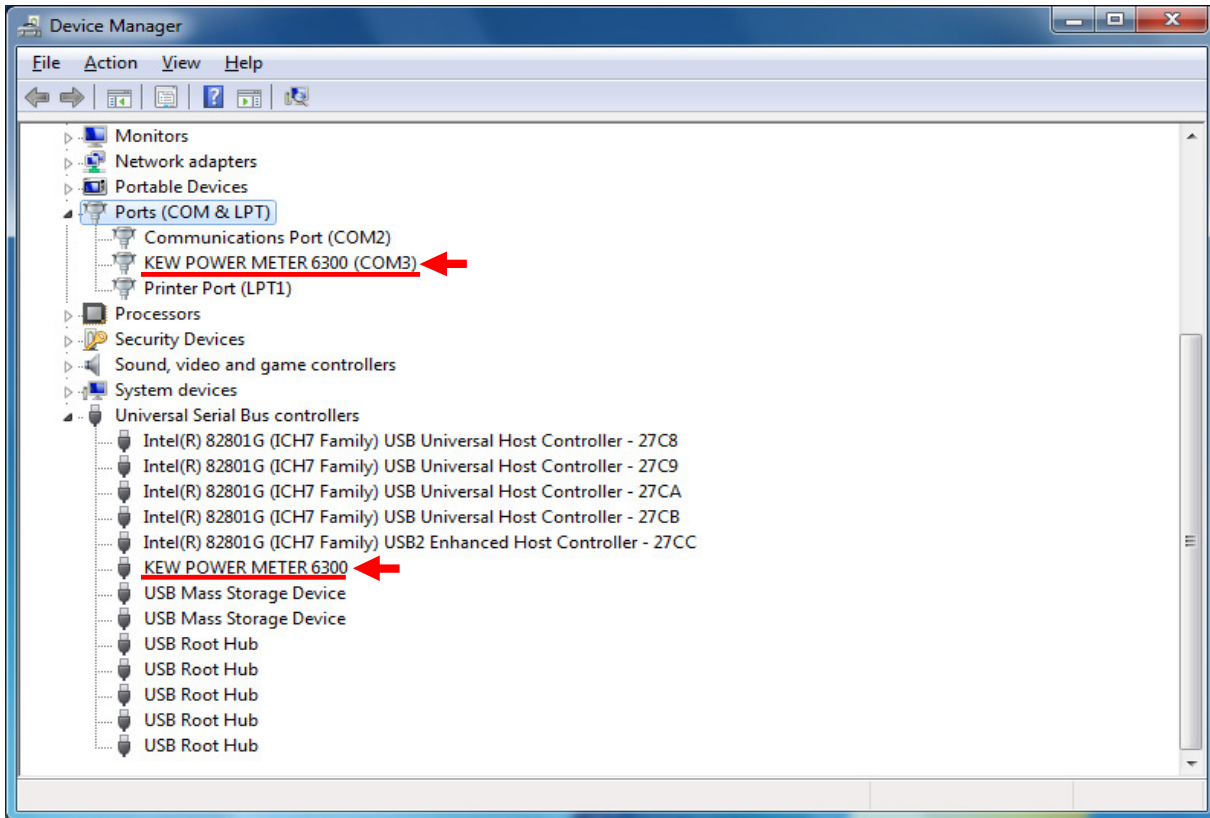
Device Manager

File   Action   View   Help

Computer
Disk drives
Display adapters
DVD/CD-ROM drives
Floppy disk drives
Floppy drive controllers
Human Interface Devices
IDE ATA/ATAPI controllers
Keyboards
Mice and other pointing devices
Monitors
Network adapters
Other devices
    USB Serial Port
Portable Devices   Update Driver Software...
Ports (COM & LPT   Disable
Processors   Uninstall
Security Devices
Sound, video and   Scan for hardware changes
System devices
Universal Serial Bus   **Properties**

(11) Repeat above step (3) through (7). Install is completed when the wizard finishes. Click "Close".

Update Driver Software - KEW POWER METER 6300 (COM3)

Windows has successfully updated your driver software

Windows has finished installing the driver software for this device:
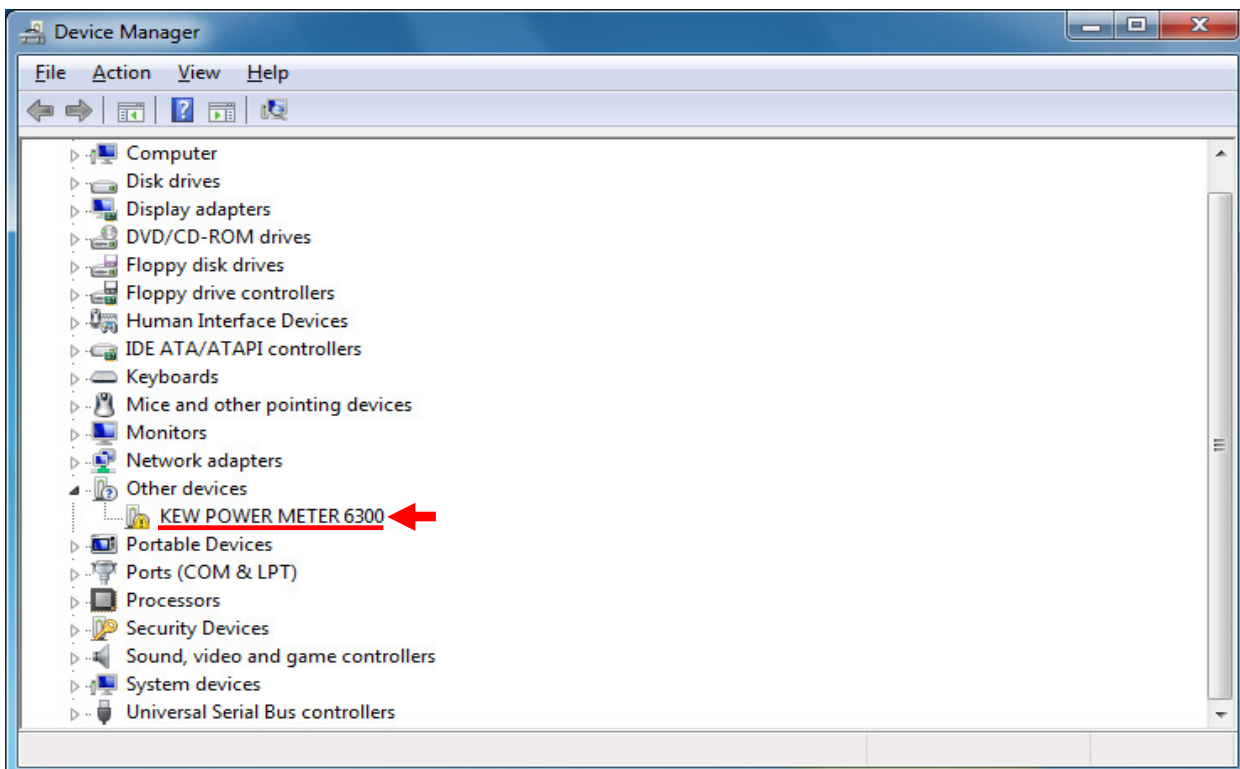
KEW POWER METER 6300

Close

(12) When 2 being installed as shown in the lower figure, a driver was normally installed.

USB Driver Un-installation

When install of the USB driver is interrupted and reinstall cannot be done, follow the procedure below and delete the existing driver, and then install it again.

(1) Connect a PC and the instrument with a USB cord.
(2) Click the "Control Panel" in the Start menu.
(3) Click "Device Manager" in the Control panel.
(4) **Right click** on "KEW POWER METER 6300" in the Other devices.
(5) Click "Uninstall" to uninstall the USB driver.

(6) Remove the USB cord connecting your PC and the instrument once, and connect them again.
(7) When "Found New Hardware Wizard" window appears, follow the procedures described at "**USB Driver Installation**" and install the driver.